

6 SPLINE QUICK CHANGE GEARS

8 3/8" RING GEAR


HIGH



LOW

• IMPORTANT •

Install Quick Change Gears With Shoulder Facing Out Toward Gear Cover Bearings

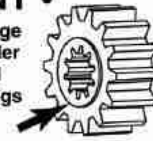

"These Quick Change gears are the best Gears you can buy for the money!"



Gear Set #	Low Spur Ratio	High Spur Ratio	No. of Teeth	3.78 R&P Ratio (9-34 Teeth)		4.11 R&P Ratio (9-37 Teeth)		4.33 R&P Ratio (9-39 Teeth)	
				Low	High	Low	High	Low	High
1	1.000	1.000	24/24	3.78	3.78	4.11	4.11	4.33	4.33
2	0.958	1.043	23/24	3.62	3.94	3.94	4.29	4.15	4.52
3	0.920	1.087	23/25	3.48	4.11	3.78	4.47	3.98	4.71
3B	0.895	1.118	17/19	3.38	4.22	3.68	4.59	3.87	4.84
3A	0.880	1.136	22/25	3.33	4.30	3.62	4.67	3.81	4.92
4	0.846	1.182	22/26	3.20	4.47	3.48	4.86	3.66	5.12
5	0.808	1.238	21/26	3.05	4.68	3.32	5.09	3.50	5.36
5A	0.792	1.263	19/24	2.99	4.77	3.25	5.19	3.43	5.47
6	0.778	1.286	21/27	2.94	4.86	3.20	5.28	3.37	5.57
24	0.767	1.304	23/30	2.90	4.93	3.15	5.36	3.32	5.65
25	0.750	1.333	18/24	2.84	5.04	3.08	5.48	3.25	5.77
7	0.741	1.350	20/27	2.80	5.10	3.04	5.55	3.21	5.85
23	0.727	1.375	16/22	2.75	5.20	2.99	5.65	3.15	5.95
8	0.714	1.400	20/28	2.70	5.29	2.94	5.75	3.09	6.06
22	0.704	1.421	19/27	2.66	5.37	2.89	5.84	3.05	6.15
9	0.696	1.438	16/23	2.63	5.43	2.86	5.91	3.01	6.22
10	0.682	1.467	15/22	2.58	5.54	2.80	6.03	2.95	6.35
11	0.667	1.500	18/27	2.52	5.67	2.74	6.17	2.89	6.50
12	0.655	1.526	19/29	2.48	5.77	2.69	6.27	2.84	6.61
13	0.652	1.533	15/23	2.47	5.80	2.68	6.30	2.82	6.64
14	0.636	1.571	14/22	2.41	5.94	2.62	6.46	2.76	6.80
15	0.625	1.600	15/24	2.36	6.05	2.57	6.58	2.71	6.93
16	0.615	1.625	16/26	2.33	6.14	2.53	6.68	2.66	7.04
17	0.600	1.667	18/30	2.27	6.30	2.47	6.85	2.60	7.22
18	0.591	1.692	13/22	2.23	6.40	2.43	6.96	2.56	7.33
18A	0.571	1.750	16/28	2.16	6.62	2.35	7.19	2.47	7.58
19	0.560	1.786	14/25	2.12	6.75	2.30	7.34	2.42	7.73
20	0.556	1.800	15/27	2.10	6.80	2.28	7.40	2.41	7.79
27	0.542	1.846	13/24	2.05	6.98	2.23	7.59	2.35	7.99
21	0.531	1.882	17/32	2.01	7.12	2.18	7.74	2.30	8.15
28	0.528	1.895	19/36	2.00	7.16	2.17	7.79	2.29	8.20
29	0.522	1.917	12/23	1.97	7.25	2.14	7.88	2.26	8.30
26	0.517	1.933	15/29	1.96	7.31	2.13	7.95	2.24	8.37
30	0.500	2.000	20/40	1.89	7.56	2.06	8.22	2.17	8.66
31	0.488	2.050	20/41	1.84	7.75	2.00	8.43	2.11	8.88
32	0.475	2.105	19/40	1.80	7.95	1.95	8.65	2.06	9.12

(Numerical Ratio listed)